



Series Datasheet - MK24 Reed Sensors

www.standexmeder.com

MK24 Series Reed Sensors

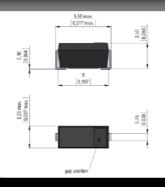

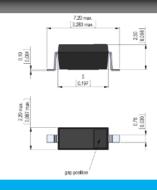

- Features: Supplied in Tape & Reel, J-Lead, Excellent for Low Power Operations
- > Applications: On/Off Control Switch, Position Detection, Sabotage Switch, Switching Element & Others
- Markets: Metering, Appliance, Telecommunication, Security, Medical & Others



Magnetic Sensitivity	Lead Design	Option		
В	2,3	Form B (Normally Closed)		
Form A (Nor				

Customer Options	Switch Model	Unit	
Contact Data	04	Unit	
Rated Power (max.) Any DC combination of V&A not to exceed their individual max.'s	3 / 1*	W	
Switching Voltage (max.) DC or peak AC	30	V	
Switching Current (max.) DC or peak AC	0.3 / 0.1*	А	
Carry Current (max.) DC or peak AC	0.5 / 0.3*	А	
Contact Resistance (max.) @ 0.5V & 50mA	200 / 250*	mOhm	
Breakdown Voltage (min.) According to EN60255-5	0.1 / 0.06*	kVDC	
Operating Time (max.) Incl. Bounce; Measured with w/ Nominal Voltage	0.25	ms	
Release Time (max.) Measured with no Coil Excitation	0.15	ms	
Insulation Resistance (typ.) Rh<45%, 100V Test Voltage	1010	Ohm	
Capacitance (typ.) @ 10kHz across open Switch	0.1	pF	
* Valid for Magnetic Sensitivity Range A			



USA: +1.866.782.6339 Europe: +49.7731.8399.0 Asia: +86.21.37820625 | salesusa@standexmeder.com | info@standexmeder.com | salesasia@standexmeder.com



Series Datasheet - MK24 Reed Sensors

www.standexmeder.com

Housing and Lead Specifications			
Housing Material Mineral Filled Epoxy			
Case Color	Black		
Lead design 1	Flat, straight leads for PCB slot mounting		
Lead design 2	Flat, bent SMD leads		
Lead design 3	J-Lead		

Environmental Data	Unit		
Shock Resistance (max.) 1/2 sine wave duration 11ms	30	g	
Vibration Resistance (max.)	20	g	
Operating Temperature	-40 to 130	°C	
Storage Temperature	-50 to 130	°C	
Soldering Temperature (max.) 5 sec. max.	260	°C	


Glossary Contact Form			
Form A	NO = Normally Open Contacts SPST = Single Pole Single Throw		
Form B	NC = Normally Closed Contacts SPST = Single Pole Single Throw		

Glossary Magnetic Sensitivity							
Sens.	А	В	С	D	Е	F	G
AT	05-10	10-15	15-20	20-25	25-30	30-35	35-40







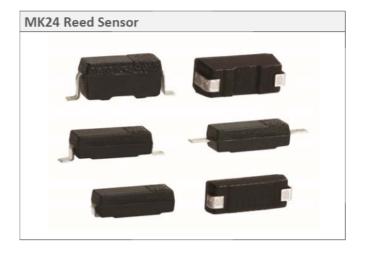

Handling & Assembly Instructions

- Use proper lead clamping or heat sinking techniques to prevent mechanical and/or heat stress during, soldering, and welding
- Mechanical shock as the result of dropping the reed sensor may cause immediate or post-installation failure
- Reflow Soldering Conditions according to JEDEC norm J-STD-020D.1

