### 3.0x2.0mm SURFACE MOUNT LED LAMP

Part Number: AA3021VWD1S White

ATTENTION OBSERVE PRECAUTIONS FOR HANDLING ELECTROSTATIC DISCHARGE SENSITIVE DEVICES

#### Features

• 3.0mm x 2.0mm, 1.3mm high, only minimum space required.

- Suitable for compact optoelectronic applications.
- Low power consumption.
- Package : 2000pcs / reel.
- Moisture sensitivity level : level 3.
- RoHS compliant.

#### Description


The source color devices are made with InGaN Light Emitting Diode.

Static electricity and surge damage the LEDS.

It is recommended to use a wrist band or anti-electrostatic glove when handling the LEDs.

All devices, equipment and machinery must be electrically grounded.

#### Package Dimensions

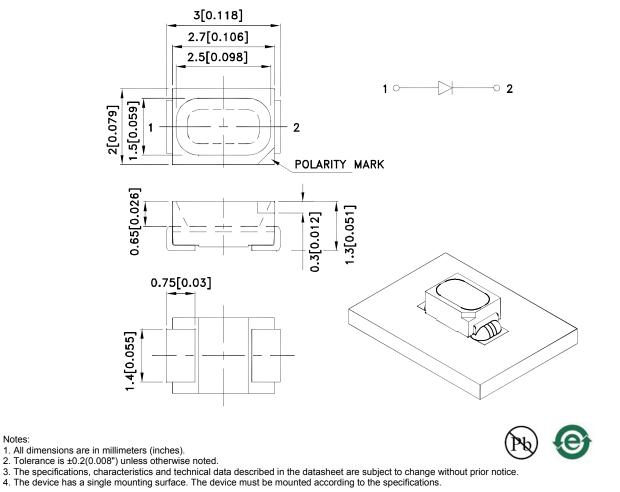


REV NO: V.2 CHECKED: Allen Liu DATE: APR/29/2011 DRAWN: D.M.Su PAGE: 1 OF 7 ERP: 1201005778

### **Handling Precautions**


Compare to epoxy encapsulant that is hard and brittle, silicone is softer and flexible. Although its characteristic significantly reduces thermal stress, it is more susceptible to damage by external mechanical force. As a result, special handling precautions need to be observed during assembly using silicone encapsulated LED products. Failure to comply might lead to damage and premature failure of the LED.

1. Handle the component along the side surfaces by using forceps or appropriate tools.




2. Do not directly touch or handle the silicone lens surface. It may damage the internal circuitry.



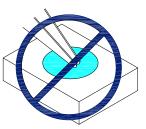


3. Do not stack together assembled PCBs containing exposed LEDs. Impact may scratch the silicone lens or damage the internal circuitry.

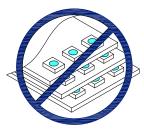

4.1. The outer diameter of the SMD pickup nozzle should not exceed the size of the LED to prevent air leaks. The inner diameter of the nozzle should be as large as possible.

4.2. A pliable material is suggested for the nozzle tip to avoid scratching or damaging the LED surface during pickup.

4.3. The dimensions of the component must be accurately programmed in the pick-and-place machine to insure precise pickup and avoid damage during production.



5. As silicone encapsulation is permeable to gases, some corrosive substances such as  $H_2S$  might corrode silver plating of leadframe. Special care should be taken if an LED with silicone encapsulation is to be used near such substances.

DATE: APR/29/2011 DRAWN: D.M.Su

#### Selection Guide

Part No.	Dice	Lens Type	lv (mcd) [2] @ 20mA		Viewing Angle [1]			
			Min.	Тур.	201/2			
AA3021VWD1S	White (InGaN)	Water Clear	1500	1900	125°			

Notes:

θ1/2 is the angle from optical centerline where the luminous intensity is 1/2 of the optical peak value.
Luminous intensity/ luminous Flux: +/-15%.

#### Electrical / Optical Characteristics at TA=25°C

Symbol	Parameter	Device Typ.		Max.	Units	Test Conditions
VF [1]	Forward Voltage	White	3.3	4.0	V	I⊧=20mA
lr	Reverse Current	White		50	uA	VR = 5V
X [2]	Chus motivity Coordinates	White	0.31			
Y [2]	Chromaticity Coordinates		0.31			
С	Capacitance	White	100		pF	VF=0V;f=1MHz


Notes:

Forward Voltage: +/-0.1V.
Measurement tolerance of the chromaticity coordinates is ±0.01.


#### Absolute Maximum Ratings at TA=25°C

Parameter	White	Units		
Power dissipation	120	mW		
DC Forward Current	30	mA		
Peak Forward Current [1]	100	mA		
Reverse Voltage	5	V		
Operating Temperature	-40°C To +85°C			
Storage Temperature	-40°C To +85°C			

Note: 1. 1/10 Duty Cycle, 0.1ms Pulse Width.

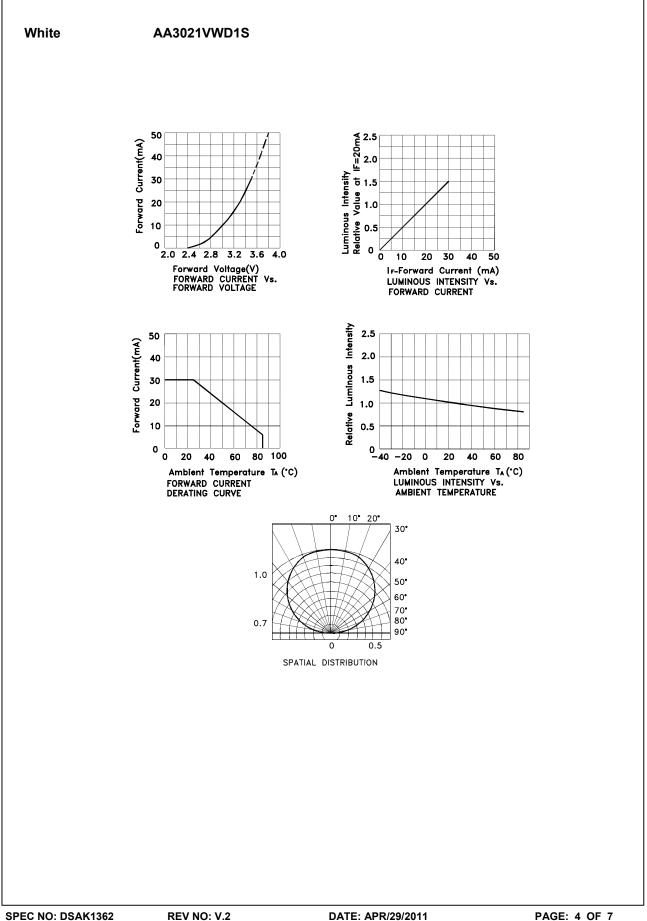

### AA3021VWD1S

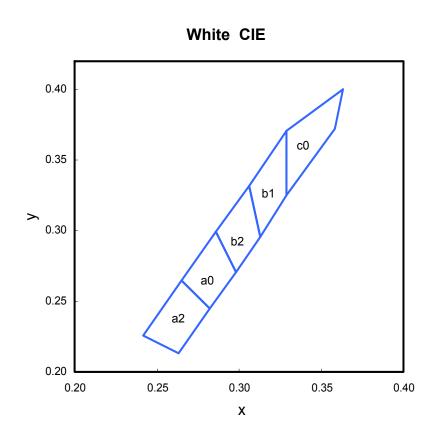


	x	У		х	у		х	у
a2	0.263	0.213	a0	0.282	0.245	b2	0.298	0.271
	0.282	0.245		0.298	0.271		0.313	0.296
	0.265	0.265		0.286	0.299		0.306	0.332
	0.242	0.226		0.265	0.265		0.286	0.299
b1	0.313	0.296	c0	0.329	0.325			
	0.329	0.325		0.358	0.372			
	0.329	0.371		0.363	0.400			
	0.306	0.332		0.329	0.371			

Notes:

Shipment may contain more than one chromaticity regions. Orders for single chromaticity region are generally not accepted. Measurement tolerance of the chromaticity coordinates is  $\pm 0.01$ .

### AA3021VWD1S

Reflow soldering is recommended and the soldering profile is shown below. Other soldering methods are not recommended as they might cause damage to the product.

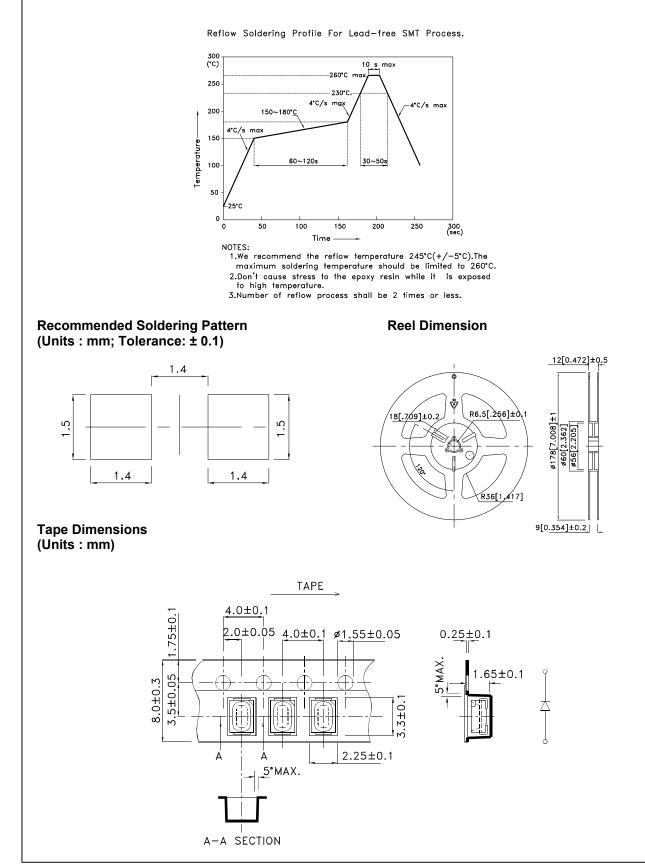

REV NO: V.2 CHECKED: Allen Liu DATE: APR/29/2011 DRAWN: D.M.Su PAGE: 6 OF 7 ERP: 1201005778

