Panasonic


Automation Controls Catalog

Solid State Relays




AQ-G RELAYS

Slim type SSR for 1 A and 2 A control

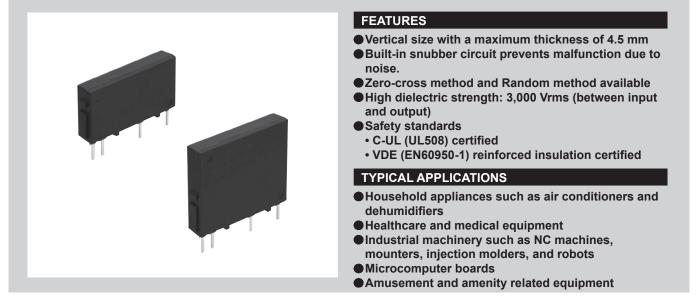

ORDERING INFORMATION (PART NO.)

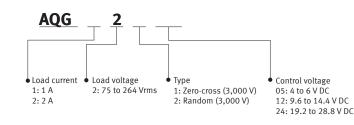

TYPES

Method	Load current	Load voltage	Control voltage	Part No.	Standard Packing
			4 to 6 V DC	AQG12105	
	1 A	75 to 264 Vrms	9.6 to 14.4 V DC	AQG12112	
Zero-cross			19.2 to 28.8 V DC	AQG12124	
Zero-cross			4 to 6 V DC	AQG22105	
	2 A	75 to 264 Vrms	9.6 to 14.4 V DC	AQG22112	
			19.2 to 28.8 V DC	AQG22124	Carton: 20 pcs.
	1 A	75 to 264 Vrms	4 to 6 V DC	AQG12205	Case: 500 pcs.
			9.6 to 14.4 V DC	AQG12212	
Random			19.2 to 28.8 V DC	AQG12224	
Random	2 A 75 to 264 Vrms		4 to 6 V DC	AQG22205	
		9.6 to 14.4 V DC	AQG22212		
			19.2 to 28.8 V DC	AQG22224	

-1-

RATING

Ratings (Ambient temperature: 20°C, Input voltage ripple: 1% or less)

•Zero-cross

Item	Part No.	AQG12105	AQG12112	AQG12124	AQG22105	AQG22112	AQG22124	Remarks			
	Rated voltage	5 V DC	12 V DC	24 V DC	5 V DC	12 V DC	24 V DC				
e	Control voltage	4 to 6 V DC	9.6 to 14.4 V DC	19.2 to 28.8 V DC	4 to 6 V DC	9.6 to 14.4 V DC	19.2 to 28.8 V DC				
Input side	Input impedance (Approx.)	0.3 kΩ	0.8 kΩ	1.6 kΩ	0.3 kΩ	0.8 kΩ	1.6 kΩ	1			
드	Drop-out voltage										
	Reverse voltage		3 V								
	Max. load current*2	1 A				2 A	1 A: Ta = Max. 40°C 2 A: Ta = Max. 25°C				
	Load voltage	75 to 264 Vrms									
	Frequency		45 to 65 Hz								
ad side	Non-repetitive surge current*3		8 A 30 A								
Load	"OFF-state" leakage current										
	"ON-state" voltage drop		at Max. carrying current								
	Min. load current ^{*4}		20 mA								

Random

Item	Part No.	AQG12205	AQG12212	AQG12224	AQG22205	AQG22212	AQG22224	Remarks			
	Rated voltage	5 V DC	12 V DC	24 V DC	5 V DC	12 V DC	24 V DC				
<u>e</u>	Input voltage	4 to 6 V DC	9.6 to 14.4 V DC	19.2 to 28.8 V DC	4 to 6 V DC	9.6 to 14.4 V DC	19.2 to 28.8 V DC				
Input side	Input impedance (Approx.)	0.3 kΩ	0.8 kΩ	1.6 kΩ	0.3 kΩ	0.8 kΩ	1.6 kΩ	*1			
드	Drop-out voltage										
	Reverse voltage		3 V								
	Max. load current*2	1 A				1 A: Ta = Max. 40°C 2 A: Ta = Max. 25°C					
	Load voltage	Load voltage 75 to 264 Vrms									
	Frequency		45 to 65 Hz								
ad side	Non-repetitive surge current*3		8 A 30 A								
Load	"OFF-state" leakage Max. 1.5 mA							at 60 Hz at 200 Vrms			
	"ON-state" voltage drop	Max. 1.6 V						at Max. carrying current			
	Min. load current ^{*4}		20 mA								


*1.Refer to REFERENCE DATA "3. Input current vs. input voltage characteristics".

*2.Refer to REFERENCE DATA *1. Load current vs. ambient temperature characteristics". *3.Refer to REFERENCE DATA *2. Non-repetitive surge current vs. carrying time". *4.When the load current is less than the rated minimum load current, please refer to "Cautions for Use of Solid State Relays".

Characteristics (Ambient temperature: 20°C, Input voltage ripple: 1% or less)

Item Type	Zero-cross	Random	Remarks
Operate time	Max. 1/2 cycle of voltage sine wave +1 ms Max. 1 ms		
Release time	Max. 1/2 cycle of volt		
Insulation resistance	Min. 10 ⁹ Ω betwee	at 500 V DC	
Breakdown voltage	3,000 Vrms betwee	for 1 minute	
Vibration resistance	10 to 55 Hz double a	X, Y, Z axes	
Shock resistance	Min. 1,0	X, Y, Z axes	
Ambient temperature	-30 to	Non-icing and non-condensing	
Storage temperature	-30 to	Non-icing and non-condensing	
Operational method	Zero-cross (Turn-ON and Turn-OFF)		


REFERENCE DATA

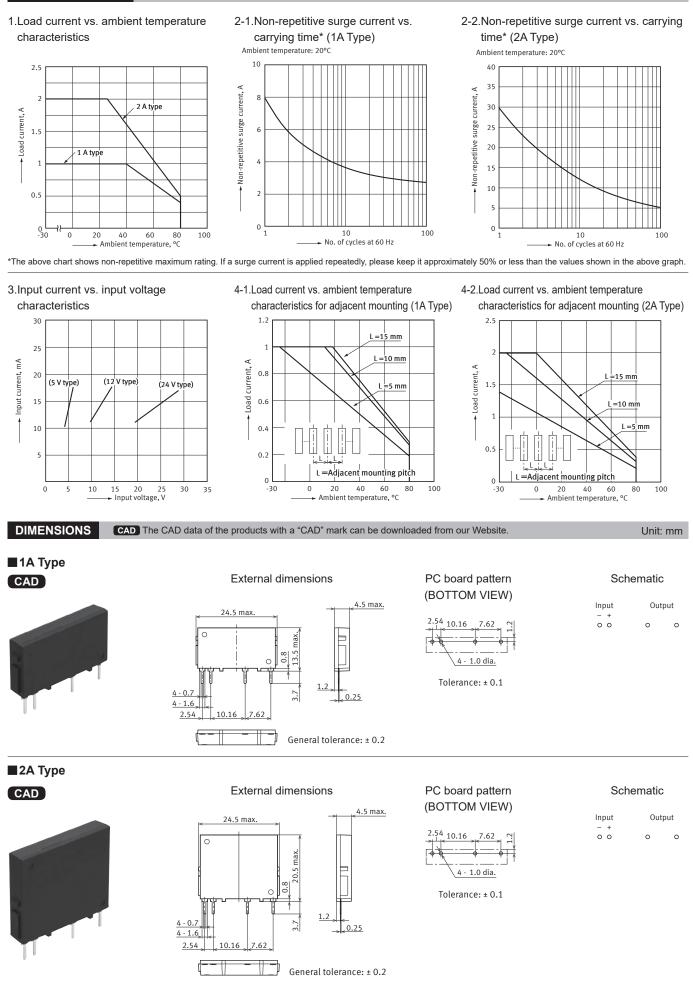

Panasonic Corporation Electromechanical Control Business Division industrial.panasonic.com/ac/e/

© Panasonic Corporation 2019

SCHEMATIC AND WIRING DIAGRAMS

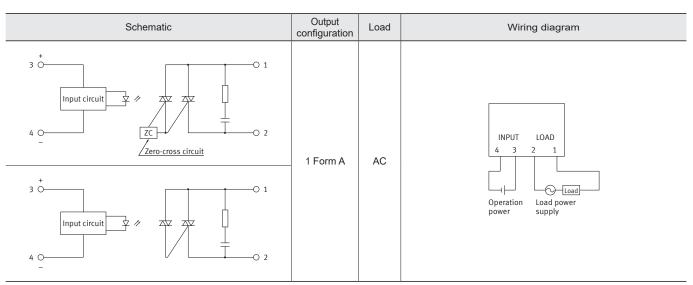

Recommended Temperature Controllers

Space saving requiring only a depth of 56 mm



KT4H Temperature Controller

- Data collection possible through a PLC using RS485 communication
- Tool port is standard for easy data setting
- Inverted LCD + backlight for good legibility with large characters
- · Excellent operability and rich optional control functions

[Substitute part numbers]

<u>r</u>									
Power supply	Control output	Part No.							
100 to 240 Vrms	Non-contact voltage output	AKT4H112100							

Note: For detailed product information about temperature controllers, please refer to our website: URL https://industrial.panasonic.com/ac/e/

> Please refer to **"the latest product specifications"** when designing your product. •Requests to customers: https://industrial.panasonic.com/ac/e/salespolicies/

- 4 —

Cautions for Use of Solid State Relays

SAFETY WARNINGS

• Do not use the product under conditions that exceed the range of its specifications. It may cause overheating, smoke, or fire.

• Do not touch the recharging unit while the power is on. There is a danger of electrical shock.

Be sure to turn off the power when performing mounting, maintenance, or repair operations on the relay (including connecting parts such as the terminal socket and socket).

Cautions for Use of Solid State Relays

1. Derating design

Derating is a significant factor for reliable design and product life. Even if the conditions of use (temperature, current, voltage, etc.) of the product are within the absolute maximum ratings, reliability may be lowered remarkably when continuously used in high load conditions (high temperature, high humidity, high current, high voltage, etc.) Therefore, please derate sufficiently below the absolute maximum ratings and evaluate the device in the actual condition.

Moreover, regardless of the application, if malfunctioning can be expected to pose high risk to human life or to property, or if products are used in equipment otherwise requiring high operational safety, in addition to designing double circuits, that is, incorporating features such as a protection circuit or a redundant circuit, safety testing should also be carried out.

2. Applying stress that exceeds the absolute maximum rating

If the voltage or current value for any of the terminals exceeds the absolute maximum rating, internal elements will deteriorate because of the overvoltage or overcurrent. In extreme cases, wiring may melt, or silicon P/N junctions may be destroyed. Therefore, the circuit should be designed in such a way that the load never exceed the absolute maximum ratings, even momentarily.

3. Phototriac coupler

The phototriac coupler is designed solely to drive a triac. As a condition, the triac must be powered beforehand.

4. Unused terminals

1) Phototriac coupler

The No. 3 terminal is used with the circuit inside the device. Therefore, do not connect it to the external circuitry. (6 pins) 2) AQ-H


The No. 5 terminal is connected to the gate. Do not directly connect No. 5 and 6 terminals.

5. Short across terminals

Do not short circuit between terminals when device is energized, since there is possibility of breaking of the internal IC.

6. When used for the load less than rated

An SSR may malfunction if it is used below the specified load. In such an event, use a dummy resistor in parallel with the load.

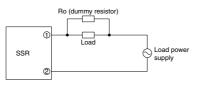

• Check the connection diagrams in the catalog and be sure to connect the terminals correctly.

If the device is energized with short circuit or any wrong connection, it may cause unexpected malfunction, abnormal heat or fire.

Load Specifications

Туре	Load current
AQ-G All models	20 mA
AQ1 All models	50 mA
AQ8 All models	50 mA
AQ-J All models	50 mA
AQ-A All models	100 mA


7. Noise and surge protection at the input side

1) Phototriac coupler and AQ-H

If reverse surge voltages are present at the input terminals, connect a diode in reverse parallel across the input terminals and keep the reverse voltages below the reverse breakdown voltage.

Typical circuits are below shown.


< Phototriac coupler (6-pin)>

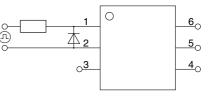

2) SSR

A high noise surge voltage applied to the SSR input circuit can cause malfunction or permanent damage to the device. If such a high surge is anticipated, use C or R noise absorber in the input circuit.

Typical circuits are below shown



8. Recommended input current of Phototriac coupler and AQ-H

Design in accordance with the recommended operating conditions for each product.

Since these conditions are affected by the operating environment, ensure conformance with all relevant specifications.

9. Ripple in the input power supply

If ripple is present in the input power supply, observe the following:


1) Current-sensitive type (Phototriac Coupler, AQ-H)

(1) For LED forward current at Emin, please maintain the value mentioned at "Recommended input current."

(2) Please make sure the LED forward current for Emax. is no higher than 50 mA.

2) Voltage-sensitive type (AQ-G, AQ1, AQ8, AQ-J, AQ-A)

(1) The Emin. should exceed the minimum rated control voltage(2) The Emax. should not exceed the maximum rated control voltage

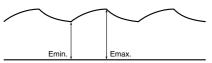

10. When the input terminals are connected with reverse polarity


Product name	If the polarity of the input control voltage is reversed
AQ1, AQ-J, AQ-A (AC)	Reversing the polarity will not cause damage to the device, due to the presence of a protection diode, but the device will not operate.
AQ-H, AQ-G, AQ8, AQ-A (DC)	Reversing the polarity may cause permanent damage to the device. Take special care to avoid polarity reversal or use a protection diode in the input circuit.

11. Noise and surge protection at the output side


1) Phototriac coupler and AQ-H

The figure below shows an ordinary triac drive circuit. Please add a snubber circuit or varistor, as noise/surge on the load side could damage the unit or cause malfunctions. Typical circuits are shown below.


<Phototriac coupler SOP4 and DIP4 types>

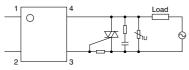

<Phototriac coupler DIP6 type>

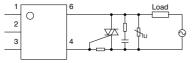

<AQ-H>




Note: Connection of an external resister, etc., to terminal No. 5 (gate) is not necessary.

2) SSR


(1) AC output type

A high noise surge voltage applied to the SSR load circuit can cause malfunction or permanent damage to the device. If such a high surge is anticipated, use a varistor across the SSR output.



(2) DC output type

If an inductive load generates spike voltages which exceed the absolute maximum rating, the spike voltage must be limited. Typical circuits are shown below.

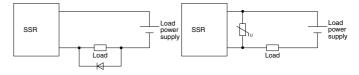

3) Clamp diode and snubber circuit can limit spike voltages at the load side. However, long wires may cause spike voltages due to inductance. It is recommended to keep wires as short as possible to minimize inductance.

4) Output terminals may become conductive although the input power is not applied, when a sudden voltage rise is applied to it even when the relay is off. This may occur even if voltage rise between terminals is less than the repetitive peak OFF-state voltage. Therefore, please perform sufficient tests with actual conditions.

5) When controlling loads in which the voltage and current phases differ, a sudden voltage rise is applied during turn-off, and the triac sometimes does not turn off. Please conduct sufficient tests using actual equipment.

6) When controlling loads using zero-cross voltage types in which the voltage and current phases differ, the triac sometimes does not turn on regardless of the input state, so please conduct sufficient tests using actual equipment.

12. Cleaning (for PC board mounting type)

Cleaning the solder flux should use the immersion washing with an organic solvent. If you have to use ultrasonic cleaning, please adopt the following conditions and check that there are no problems in the actual usage.

• Frequency: 27 to 29kHz

- Ultrasonic output: No greater than 0.25W/cm² (Note)
- Cleaning time: 30s or less
- Cleanser used: Asahiklin AK-225
- Others: Float PC board and the device in the cleaning solvent to prevent from contacting the ultrasonic vibrator. Note: Applies to unit area ultrasonic output for ultrasonic baths

13. Notes for mounting (for PC board mounting type)

1) When different kinds of packages are mounted on PC board, temperature rise at soldering lead is highly dependent on package size. Therefore, please set the lower temperature soldering condition than the conditions of item "14. Soldering", and confirm the temperature condition of actual usage before soldering.

2) When mounting condition exceeds our recommendation, the device characteristics may be adversely affected. It may occur package crack or bonding wire breaking because of thermal expansion unconformity and resin strength reduction. Please contact our sales office about the propriety of the condition.
3) Please confirm the heat stress by using actual board because it may be changed by board condition or manufacturing process condition

4) Solder creepage, wettability, or soldering strength will be affected by the mounting condition or used soldering type. Please check them under the actual production condition in detail.

5) Please apply coating when the device returns to a room temperature.


— 6 —

14. Soldering

1) When soldering surface-mount terminals, the following conditions are recommended.

(1) IR (Infrared reflow) soldering method

(Recommended condition reflow: Max. 2 times, measurement point: soldering lead)

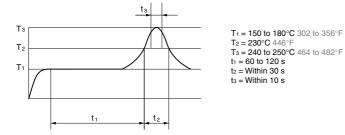

(2) Other soldering methods

Other soldering methods (VPS, hot-air, hot plate, laser heating, pulse heater, etc.) affect the relay characteristics differently, please evaluate the device under the actual usage. (3) Soldering iron method


Tip temperature: 350 to 400°C 662 to 752°F Wattage: 30 to 60 W

Soldering time: within 3 s

2) When soldering standard PC board terminals, the following conditions are recommended.

(1) DWS soldering method

(Recommended condition number of times: Max. 1 time, measurement point: soldering lead *1)

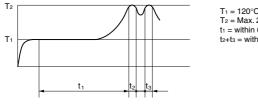

 $T_1 = 120^{\circ}C 248^{\circ}F$ $T_2 = Max. 260^{\circ}C 500^{\circ}F$ $t_1 = within 60 s$ $t_2+t_3 = within 5 s$

*1 Solder temperature: Max. 260°C 500°F

(2) Other dip soldering method (recommended condition: 1 time) Preheating: Max. 120°C 248°F, within 120 s, measurement point: soldering lead

Soldering: Max. 260°C 500°F, within 5 s*, measurement area: soldering temperature

*Phototriac coupler and AQ-H: within 10 s

(3) Manual soldering method Tip temperature: 350 to 400°C 662 to 752°F Wattage: 30 to 60 W Soldering time: within 3 s

• We recommend one with an alloy composition of Sn3.0Ag0.5Cu.

15. Others

 If an SSR is used in close proximity to another SSR or heatgenerating device, its ambient temperature may exceed the allowable level. Carefully plan SSR layout and ventilation.
 Terminal connections should be made by referring to the associated wiring diagram.

3) For higher reliability, check device quality under actual operating conditions.

4) To prevent the danger of electrocution, turn off the power supply when performing maintenance. Although AQ-A (DC output type) is constructed with insulation for the input/output terminals and the rear aluminum plate, the insulation between the input/output and the rear aluminum plate is not UL approved.

16. Transportation and storage

1) Extreme vibration during transport may deform the lead or damage the device characteristics. Please handle the outer and inner boxes with care.

2) Inadequate storage condition may degrade soldering, appearance, and characteristics. The following storage conditions are recommended:

- Temperature: 0 to 45°C 32 to 113°F
- Humidity: Max. 70%RH
- Atmosphere: No harmful gasses such as sulfurous acid gas, minimal dust.

3) Storage of Phototriac coupler (SOP type)

In case the heat stress of soldering is applied to the device which absorbs moisture inside of its package, the evaporation of the moisture increases the pressure inside the package and it may cause the package blister or crack. This device is sensitive to moisture and it is packed in the sealed moisture-proof package. Please make sure the following condition after unsealing.

Please use the device immediately after unsealing. (Within 30 days at 0 to 45°C 32 to 113°F and Max. 70%RH)
If the device will be kept for a long time after unsealing, please store in the another moisture-proof package containing silica gel. (Please use within 90 days.)


17. Water condensation

Water condensation occurs when the ambient temperature changes suddenly from a high temperature to low temperature at high humidity, or the device is suddenly transferred from a low ambient temperature to a high temperature and humidity. Condensation causes the failures such as insulation deterioration. Panasonic Corporation does not guarantee the failures caused by water condensation.

The heat conduction by the equipment the SSR is mounted may accelerate the water condensation. Please confirm that there is no condensation in the worst condition of the actual usage. (Special attention should be paid when high temperature heating parts are close to the SSR.)


— 7 —

18. The following shows the packaging format

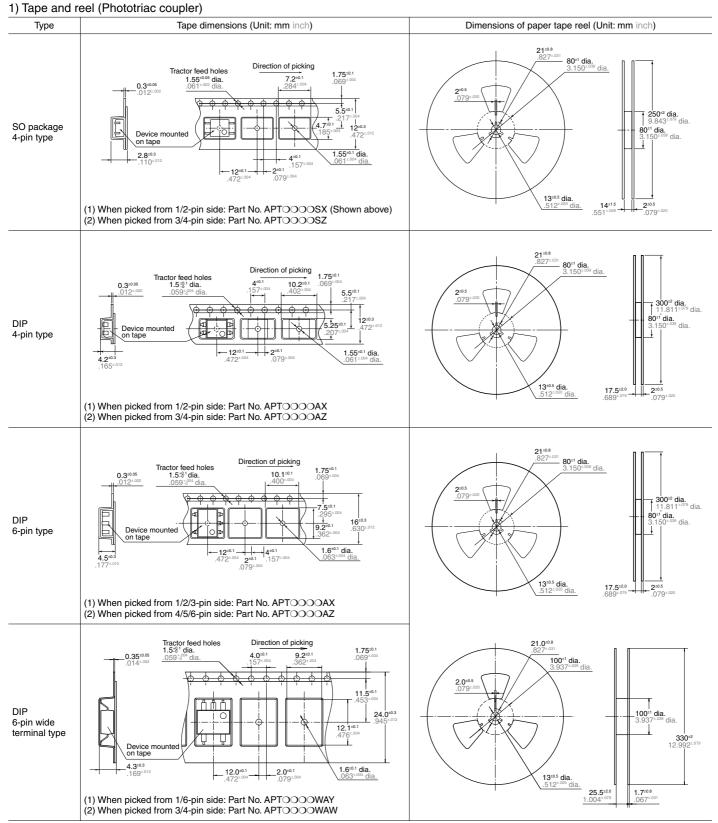

© Panasonic Corporation 2018

2) Tape and reel (AQ-H)

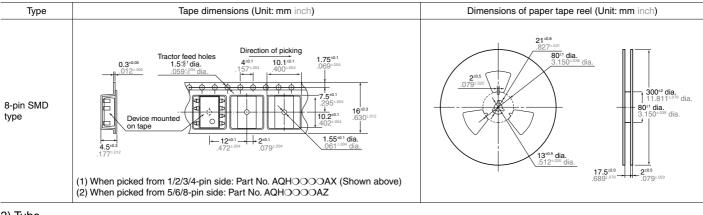

3) Tube

Phototriac coupler and AQ-H SSR are packaged in a tube as pin No. 1 is on the stopper B side. Observe correct orientation when mounting them on PC boards.

<Phototriac coupler SOP type>

<Phototriac coupler DIP type and AQ-H SSR>



Snubber Circuit

1. Reduce dv/dt

An SSR used with an inductive load can accidentally fire due to a high load voltage rise rate (dv/dt), even though the load voltage is below the allowable level (inductive load firing). Our SSRs contain a snubber circuit designed to reduce dv/dt (except AQ-H).

2. Selecting the snubber constants


1) C selection

The charging coefficient tau for C of the SSR circuit is shown in formula 1

By setting formula (1) so that it is below dv/dt value you have: C=0.632V_{4}/[(dv/dt) \times (R_{L}+R)] -----(2)

By setting C = 0.1 to 0.2 μ F, dv/dt can be controlled to between nV/ μ s and n+V/ μ s or lower. For the condenser, use either an MP condenser metallized polyester film. For the 100 V line, use a voltage between 250 and 400 V, and for the 200 V line, use a voltage between 400 and 600 V.

2) R selection



If there is no resistance R (the resistance R controls the discharge current from condenser C), at turn-on of the SSR, there will be a sharp rise in dv/dt and the high peak value discharge current will begin to flow.

This may cause damage to the internal elements of the SSR. Therefore, it is always necessary to insert a resistance R. In normal applications, for the 100 V line, have R = 10 to 100 Ω and for the 200 V line, have R = 20 to 100 Ω . (The allowable discharge current at turn on will differ depending on the internal elements of the SSR.) The power loss from R, written as P, caused by the discharge current and charging current from C, is shown in formula ③ below. For the 100 V line, use a power of 1/2 W, and for the 200 V line, use a power above 2 W.

f = Power supply frequency

Also, at turn-off of the SSR, a ringing circuit is formed with the capacitor C and the circuit inductance L, and a spike voltage is generated at both terminals of the SSR. The resistance R serves as a control resistance to prevent this ringing. Moreover, a good non-inductive resistance for R is required. Carbon film resistors or metal film resistors are often used.

For general applications, the recommended values are C = 0.1 μ F and R = 20 to 100 Ω . There are cases of resonance in the inductive load, so the appropriate care must be taken when making your selections.

Thermal Design

SSRs used in high-reliability equipment require careful thermal design. In particular, junction temperature control has a significant effect on device function and life time. The rated load current for PC board-mounting SSRs is defined as the maximum current allowable at an ambient temperature of 40°C 104°F (30°C 86°F) and under natural cooling. If the ambient temperature exceeds the SSRs derating temperature point [40°C 104°F (30°C 86°F)], load current derating in accordance with the load current vs temperature diagram becomes necessary.

If adjacent devices act as heat sources, the SSR should be located more than 10 mm away from those devices.

SSRs with a 5 A rating or more must be used with the dedicated heat sinks listed in Table 1 or equivalents. To ensure adequate thermal conduction, apply thermal conductive compound (Ex. Momentive Performance Materials Inc. YG6111 or TSK5303) to the SSR's mounting surface.

For information on external heat sinks for our SSRs and their mounting method, refer to "Data and Cautions for Use for respective relay".

Table 1 Dedicated on-board heat sinks

3) Use a surge absorption circuit

supply or SSR.

Panasonic Corporation).

Туре	Heat sink	Load current	
AQ10A2-ZT4/32VDC	AQ-HS-5A	10A	
	AQP-HS-SJ10A*		
AQ-J (10A)	AQP-HS-J10A	10A	
	AQP-HS-SJ20A*		
	AQP-HS-SJ10A*		
AQ-J (15A)	AQP-HS-J10A	15A	
	AQP-HS-SJ20A*	7	
	AQP-HS-SJ10A*		
	AQP-HS-J10A	20A	
AQ-J (25A)	AQP-HS-SJ20A*		
	AQP-HS-J25A	25A	
AQ-A (15A)	AQP-HS-J10A	15.4	
AQ-A (15A)	AQP-HS-SJ20A*	- 15A	
	AQP-HS-30/40A		
AQ-A (25A)	AQP-HS-J10A	25A	
	AQP-HS-SJ20A*		
	AQP-HS-J10A		
AQ-A (40A)	AQP-HS-SJ20A*		
AQ-A (40A)	AQP-HS-30/40A	- 40A	
	AQP-HS-J25A	40A	
	AQP-HS-SJ20A*	8A	
AQ-A DC (10A)	AQP-HS-J25A	10A	
AQ-A DC (30A)	AQP-HS-SJ20A*	30A	

Protection Circuit

High-reliability SSR circuits require an adequate protection circuit, as well as careful study of the characteristics and maximum ratings of the device.

1. Over-Voltage Protection

The SSR load power supply requires adequate protection against over-voltage errors from various causes. The methods of over-voltage protection include the following:

1) Use devices with a guaranteed reverse surge withstand voltage

(controlled avalanche devices, etc.)

2) Suppress transient spikes

Use a switching device in the secondary circuit of a transformer or use a switch with a slow opening speed.

Choosing the rated voltage of the ZNR

(1) Peak supply voltage

(2) Supply voltage variation

(3) Degradation of ZNR characteristic (1 mA±10%)

(4) Tolerance of rated voltage ($\pm 10\%$)

For application to 100 V AC lines, choose a ZNR with the following rated voltage:

 $(1) \times (2) \times (3) \times (4) = (100 \times \sqrt{2}) \times 1.1 \times 1.1 \times 1.1 = 188$ (V)

Example of ZNR (Panasonic)

0.8 dia 3.0 max. T: 6.5 max. H: 20.5 max

Use a CR surge absorber or varistor across the load power

Special care must be taken so power on/off surges or external surges do not exceed the device's rated load voltage. If a surge

voltage exceeding the device's rated voltage is anticipated, use

a surge absorption device and circuit (e.g. a ZNR from

D: 17.5 dia. max W: 7.5±1 298±.039 (Unit: mm inch)

Types	Varistor voltage	Max. allowable circuit		Max. control	Max. average pulse electric power	Withstanding energy		Withstanding surge current		Electrostatic
			voltage			(10/1000µs)	(2ms)	1time	(8/20μs) 2time	capacitance (Reference)
	V1mA (V)	ACrms (V)	DC (V)	V50A (V)	(W)	(J)	(J)	(A)	(A)	@1KHz (pF)
ERZV14D201	200 (185 to 225)	130	170	340	0.6	70	50	6,000	5,000	770
ERZV14D221	220 (198 to 242)	140	180	360	0.6	78	55	6,000	5,000	740
ERZV14D241	240 (216 to 264)	150	200	395	0.6	84	60	6,000	5,000	700
ERZV14D271	270 (247 to 303)	175	225	455	0.6	99	70	6,000	5,000	640
ERZV14D361	360 (324 to 396)	230	300	595	0.6	130	90	6,000	4,500	540
ERZV14D391	390 (351 to 429)	250	320	650	0.6	140	100	6,000	4,500	500
ERZV14D431	430 (387 to 473)	275	350	710	0.6	155	110	6,000	4,500	450
ERZV14D471	470 (423 to 517)	300	385	775	0.6	175	125	6,000	4,500	400
ERZV14D621	620 (558 to 682)	385	505	1,025	0.6	190	136	5,000	4,500	330
ERZV14D681	680 (612 to 748)	420	560	1,120	0.6	190	136	5,000	4,500	320

2. Over-Current Protection

An SSR circuit operated without overcurrent protection may result in damage to the device. Design the circuit so the device's rated junction temperature is not exceeded for a continuous overload current.

(e.g. Surge current into a motor or light bulb)

The surge-on current rating applies to over-current errors which occur less than several tens of times during the service life of a semiconductor device. A protection coordination device is required for this rating.

Methods of over-current protection include the following: 1) Suppressing over-currents

Use a current limiting reactor in series with the load power supply.

2) Use a current shut-off device

Use a current limiting fuse or circuit breaker in series with the load power supply.

Load Type Description

1. Heaters (Resistive load)

The SSR is best suited to resistive loads. Noise levels can be drastically lowered with zero-crossing switching.


2. Lamps

Tungsten or halogen lamps draw a high inrush current when turned on (approximately 7 to 8 times the steady state current for zero-crossing SSRs; approximately 9 to 12 times, in the worst case, for random type SSRs). Choose an SSR so the peak of the inrush current does not exceed 50% of the SSR surgeon current.

3. Solenoids

AC-driven solenoid contactors or solenoid valves also draw inrush current when they are activated. Choose an SSR such that the peak of the inrush current does not exceed 50% of the SSR surgeon current. For small solenoid valves and AC relays in particular, a leakage current may cause the load to malfunction after the SSR turns off. In such an event, use a dummy resistor in parallel with the load.

• Using an SSR below the specified load




4. Motors load

When starting, an electric motor draws a symmetrical AC starting current some 5 to 8 times the steady-state load current, superimposed on a DC current. The starting time during which this high starting current is sustained depends on the capacities of the load and load power supply. Measure the starting current and time under the motor's actual operating conditions and choose an SSR so the peak of the starting current does not exceed 50% of the SSR surge-on current.

When the motor load is deactivated, a voltage exceeding the load supply voltage is applied to the SSR due to counter-EMF. This voltage is approximately 1.3 times the load supply voltage for induction motors, and approximately 2 times that for synchronous motors.

Example of executing fuse selection of over-current protection cooperation

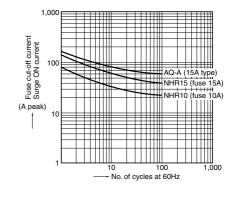

• Reversible motor control

When the direction of motor rotation is reversed, the transient current and time required for the reversal far exceed those required for simple starting. The reversing current and time should also be measured under actual operating conditions. For a capacitor-starting, single-phase induction motor, a capacitive discharge current appears during the reversal process. Be sure to use a current limiting resistor or reactor in series with the SSR.

Also, the SSR should have a high marginal voltage rating, since a voltage twice as high as the load supply voltage develops across the SSR in the reversal process.

For reversible motor control, carefully design the driver circuit so the forward and reverse SSRs do not turn on at the same time.

5. Capacitive load

A capacitive load (switching regulator, etc.) draws an inrush current to charge the load capacitor when the SSR turns on. Choose an SSR so the peak of the inrush current does not exceed 50% of the SSR surge-on current. A timing error of up to one cycle can occur when a switch used in series with the SSR is opened or closed. If this is a problem, use an inductor (200 to $500 \ \mu\text{H}$) in series to the SSR to suppress dv/dt error.


6. Other electronic equipment

In general, electronic equipment uses line filters in the primary supply circuit.


The capacitors used in the line filters may cause the SSR to malfunction due to dv/dt turn on when the equipment is turned on or off. In such an event, use an inductor (200 to 500 μ H) in series with the SSR to suppress dv/dt turn on.

— 11 —


Load Inrush Current Wave and Time

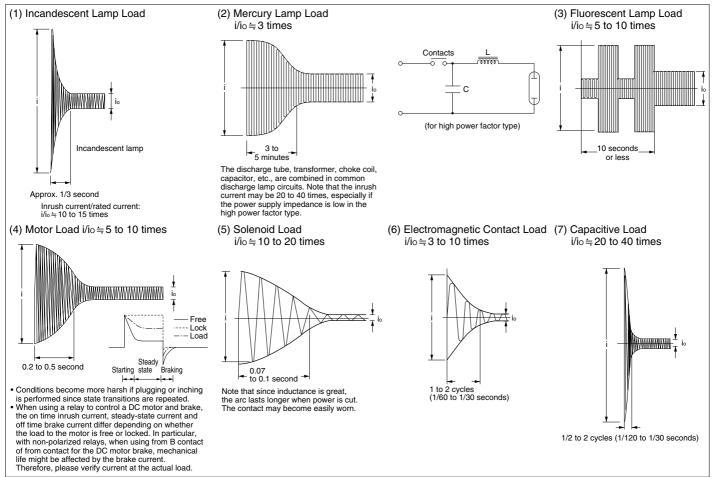


SSR Driving Circuits

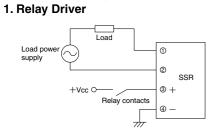


2. NPN Transistor Driver

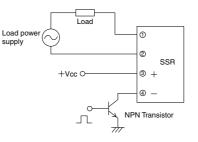

3. PNP Transistor Driver

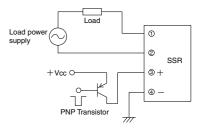


4. TTL/DTL/IC Driver

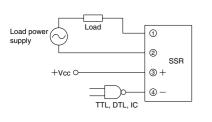


5. C-MOS/IC Driver


(1) SSR fires when IC output is HIGH:

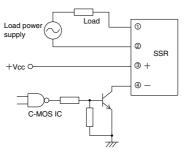


(2) SSR fires when IC output is LOW:

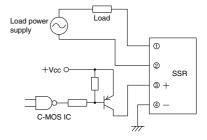

6. Self Sustaining Circuit Using SSR

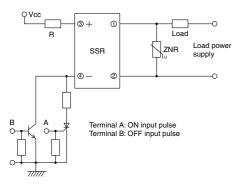


7. Driving with a Shared Supply

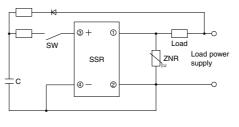

Phototriac Coupler, AQ-H Solid State Relay Driving Circuits

*Phototriac coupler and AQ-H is current driving type

1. NPN Transistor Driver

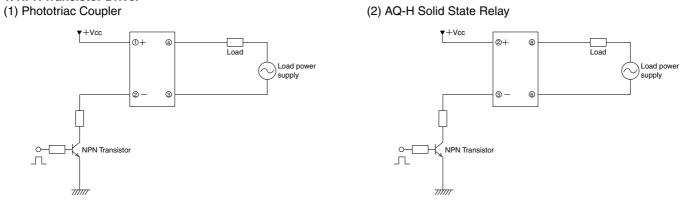

Please contact

Panasonic Corporation

Electromechanical Control Business Division 1006, Oaza Kadoma, Kadoma-shi, Osaka 571-8506, Japan industral.panasonic.com/ac/e/



©Panasonic Corporation 2019

Specifications are subject to change without notice.